




CHEVRON 45° | TECHNICAL INFORMATION

Product # 1173-4248-10

COSWICK
Solid Hardwood Floors

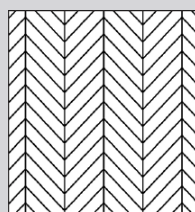

DESIGNER SOLUTION COLLECTION DECOR | LAKE ELTON

Wood species Oak
Selection | Tavern
Pattern | Chevron
Constructions 3-layer flooring T&G
Size | 15x82,55x490 mm (5/8"x3 1/4"x19 5/16")
Finish | Silk finish

CONSTRUCTION: 3-LAYER FLOORING T&G

DIMENSIONS :			PACKAGING :	
			BOX	PALLET
Thickness	15 mm (5/8")		Content 1,618 m ²	54 box (87,372 m ²)
Width	82,55 mm (3 1/4")		Weigh 17 kg	937 kg
Length	490 mm (19 5/16")		H x W x L 155 x 345 x 620 mm	1080 x 1 065 x 2 020 mm
Cut angle	45°		Content 17,410 sq.ft.	940,123 sq.ft.
Microbevel	0,5 mm		Weigh 18 lb	961 lb
Joint type	T&G		H x W x L 6" x 14" x 25" mm	43" x 42" x 80" mm

DEVIATIONS:

Deviation on Thickness	± 0,2 mm	EN 13489 ГОСТ 862.3
Deviation on Length	± 0,3 mm	
Deviation on Width	± 0,2 mm	
Angle deviation of planks	≤ 0,25 mm	EN 13489
Cup	≤ 0,2 % of width	
Bow	≤ 0,5 % of length	
Spring	≤ 0,1 % of length	

CHARACTERISTICS:

Fire resistance	Dfl-s1	EN 14342
Formaldehyde emission class	E1	
Pentachlorophenol content	None	
Thermal resistance	0,095 m ² K/W	
Thermal conductivity	0,158 W/(m·K)	
Structural warranty	Lifetime	

INSTALLATION :



Glue down over concrete, plywood or wooden subfloor or nail down over wooden subfloor. Applicable above, on and below ground level. Suitable for installation over radiant heating systems.

STORAGE AND USAGE :



— Air humidity 40% – 65%
— Temperature +18 °C – +22 °C

FINISH : SILK FINISH

DESCRIPTION	
Type of coating	UV-cured modified polyurethane-acrylate
Surface (finish) type	Semi-closed pores, wire brushed
Sheen	Silk matte 9-18 GU/85°
Finish warranty	-

CLASSIFICATION SURFACE CHARACTERISTICS:

Wear resistance	Not rated	EN 438-2
Scratch resistance	Not rated	EN 438
Slip resistance	50 (SRV dry)	EN 15676
Resistance to chemical agents	Class 5 (Except blue ink)	EN 13442
Repairability	Medium	

MAINTENANCE AND CARE CONDITIONS :

Maintenance of hardwood floors with Silk finish assumes regular (daily if necessary) cleaning from dust and grit using a vacuum, followed by a thorough cleaning with Coswick Hardwood Floor Cleaner or other similar product. Floor surface areas that receive the most traffic and get worn down quicker, such as areas by the front door, hallways, kitchens etc., should be periodically renewed with special Coswick Restorative Oil. This product restores the protective surface film. Frequency of use depends on type of interior and intensity of foot traffic. For residential interiors, restorative cleaning should be done once in 3-5 years; for public and commercial interiors with intense foot traffic, it is recommended to use the product 2-4 times a year.

SELECTION TAVERN

DESCRIPTION:		DESCRIPTION:	
Sound sapwood	Up to 25% of board width is allowed	Bark pocket	No limit (after filling)
Colour variation	Moderate contrast allowed	Pith	Permitted
Knot	Permitted big, filled	Slope of grain	Permitted
Cracks	Permitted wide, filled	Medullary ray	Permitted

COSWICK Ltd.

2B Kolasa Str., 223034 Zaslavl, Republic of Belarus

Tel.: +375-17-543-2012, Fax: +375-17-543-2020, E-mail: sales@coswick.com

www.coswick.com

